


SHIMBOL

MONITOR M7

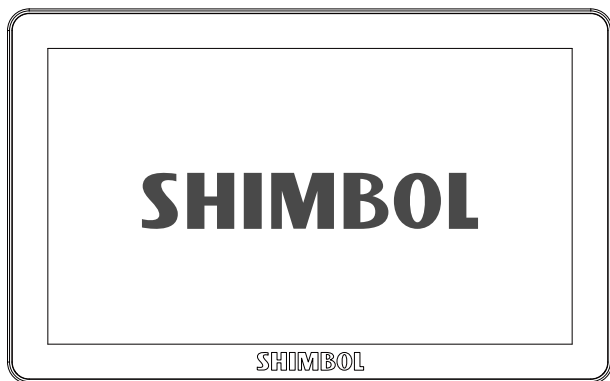

Instruction Manual

Shenzhen ZO Video Technology Co., Ltd.

封面

尺寸:105x142mm

材质:157铜板+打钉

2024.1.18 P15

表格线条修改

2024.1.25 P15 参数LUT输出被折叠

封底 修改英文地址

2024.03.14 修改P15参数亮度

文件编号:ZO-M7-ML(说明书)-英文

版本号: A-2

制作: 张鑫

日期: 2024-03-14

确认:

审核:

深圳市零壹视讯科技有限公司

Shenzhen ZO video technology Co.,Ltd.

Packing list

Carry Case



Monitor




Tempered Screen Protector




User Manual




HDMI Cable



SDI Cable

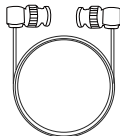

Hot Shoe Mount



Dusting Cloth



SD card



Carry Case*1

Monitor*1

Tempered Screen
Protector*1

User Manual*1

HDMI Cable*1


SDI Cable*1

Hot Shoe Mount*1

Dusting Cloth*1

SD card*1

Buttons And Ports

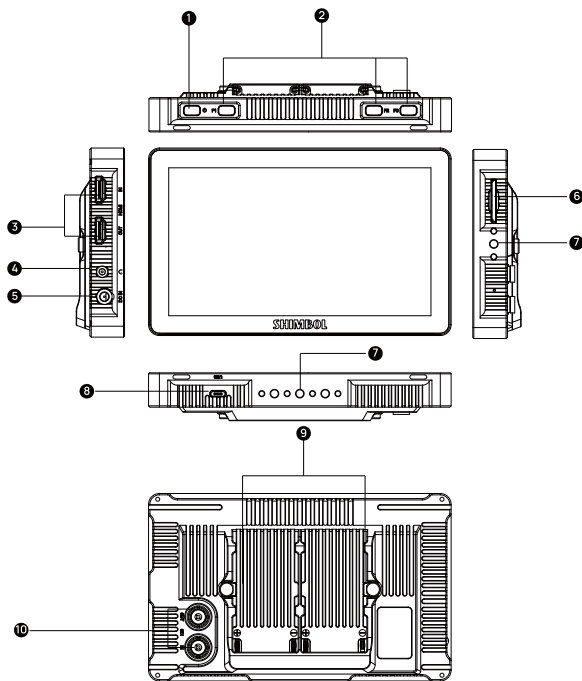

- 1 Power ON/
OFF Button
- 2 Custom Function Buttons
- 3 HDMI Interfaces
- 4 3.5mm Headphone Jack
- 5 DC Input
- 6 SD Card Slot
- 7 1/4"-20 Thread Hole
- 8 USB Upgrade Port Hole
- 9 NP-F Battery Plate
- 10 SDI Interfaces

I . Monitors Assist Icons



Switching
Signal



Input

HDMI-SDI



Scope Menu



Waveform

shows the levels
of brightness from an
input source



RGB-Paral

monitor the
level of red,
green and blue
from an input
source



Histogram

this is useful for
checking if an image
is under or over
saturated.



Vector

visualize the
dynamic
range of
your image



Marker Menu



Marker

mark through
your chosen
aspect ratio



Safe area

action area
and title safe
areas displayed



Anamorphic

allows you to
see a correctly
squeezed image
when using
anamorphic lenses



Center marker

mark image
center



Matte

Multiple modes
are available



Grid

Multiple lines
are selected

I . Monitors Assist Icons



Focus Menu



Peaking

ensure your recordings are always in focus



Zoom

zoom in image



Exposure Menu



Zebra

use zebra to check exposure and set exposure levels



False color

a visualization of exposure across the image



Monochrome

monochrome display mode



Color Menu



3D-LUT

3D-LUT loading & updating



Gamma

gamma setting



HDR

HDR monitoring



Color temperature

color temperature setting

Catalog


I . Monitors Assist Icons-----	3
II . User Interface -----	6
III. Operation Guide -----	8
1. Boot Method -----	8
2. RGB Gain and Offset-----	8
3. Format SD Card -----	9
4. Shortcut Key Preset-----	9
5. High Precision Waveform-----	10
6. Matte-----	10
7. Peaking -----	11
8. HDR Monitoring-----	11
9. 3D-LUT Input Method -----	12
10. 3D-LUT Output Method -----	13
11. DCI-P3 -----	13
IV. Notes-----	14
1. Exceptions in Connection -----	14
2. SD card Description-----	14
V . Technical Parameters-----	15

II . User Interface




- ① Video Input ② Resolution ③ Zoom ④ SD Card
- ⑤ 3D-LUT ⑥ Power Indication ⑦ Switching Signal ⑧ Waveform Menu
- ⑨ Marker Menu ⑩ Focus Menu ⑪ Exposure Menu ⑫ Color Menu
- ⑬ System Settings ⑭ Lock Screen ⑮ Audio Meter


II . User Interface

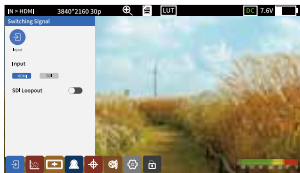


Switching Signal

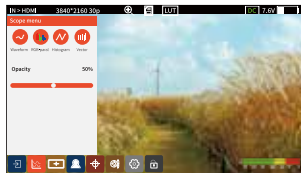


Scope Menu

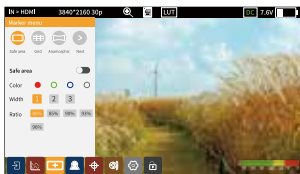

Marker Menu

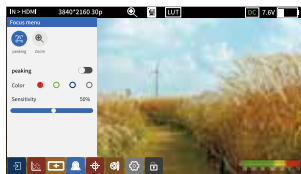

Focus menu

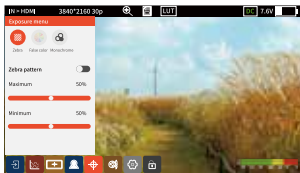


Exposure menu



Color menu

II . User Interface

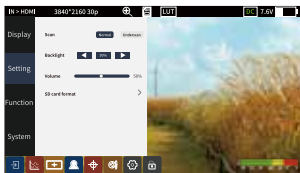

System Settings Menu




Lock Screen

III. Operation Guide

1.Boot Method


Short press the power on/off button to turn on the monitor, long press 3 seconds to turn it off.

2.RGB Gain and Offset

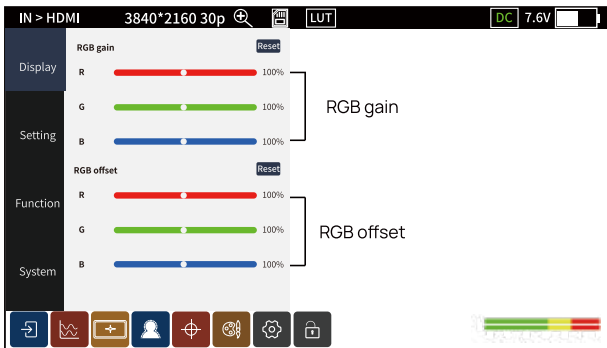


III. Operation Guide

3.Format SD Card

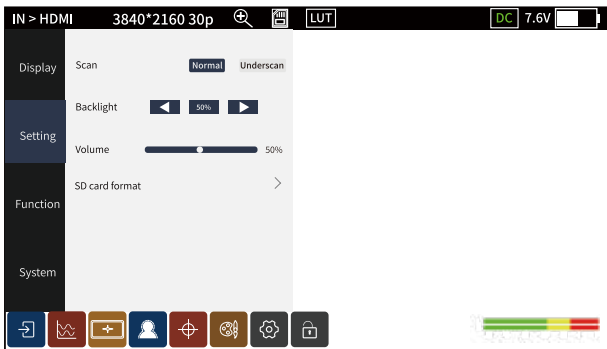


4.Shortcut Key Preset

There are two shortcut keys, F1 and F2、 F3, on the top of the host, and you can choose function presets.

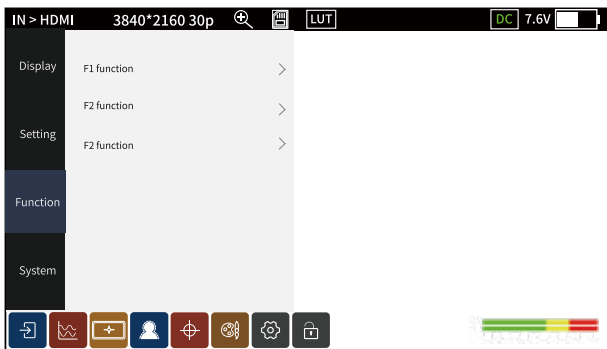


III. Operation Guide

5.High Precision Waveform

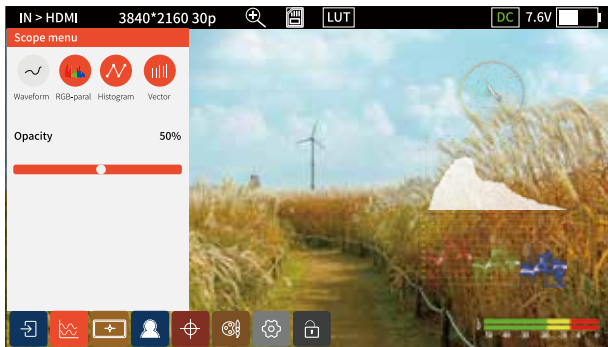


6.Matte

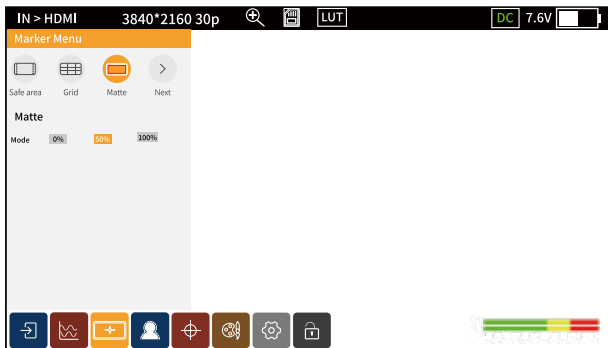


III. Operation Guide

7. Peaking

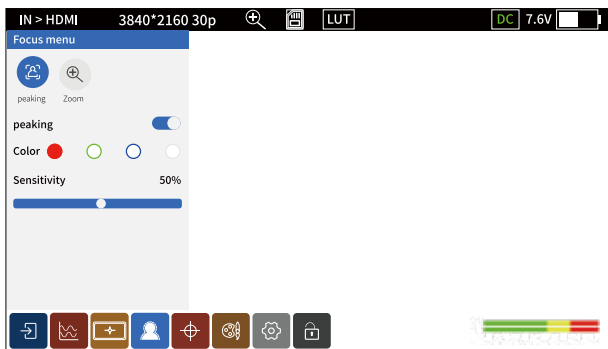


8. HDR Monitoring

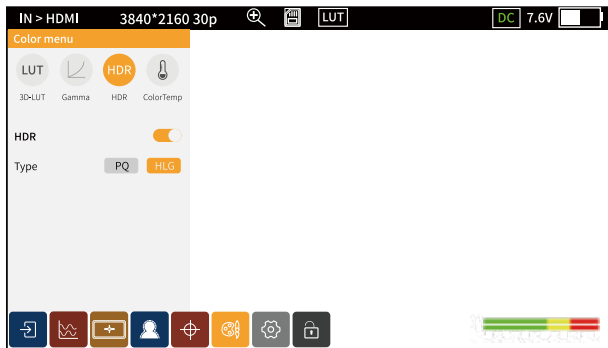

III. Operation Guide

9.3D-LUT Input Method

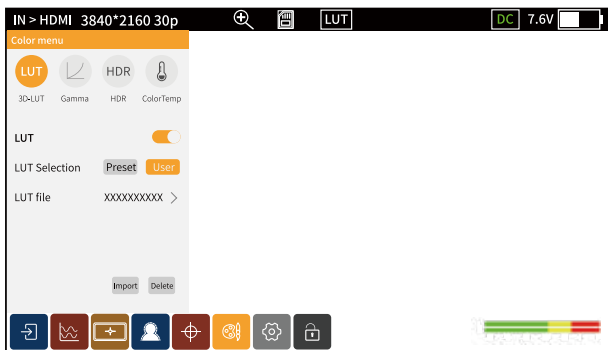


- 1 Place the LUT file in the LUT folder on the SD card and insert the SD card into the monitor
- 2 Click the Color Menu-3D-LUT, turn on , and then selecting Custom, click the Import button and wait for the system to retrieve the LUT file in the SD card that needs to be loaded
- 3 Click on the LUT file that needs to be loaded, then click Import and wait for the file to be imported into the system
- 4 Click the LUT file, enter the file selection, select the desired LUT, and click to confirm that the LUT is loaded successfully

Note: LUT file name only support English, do not allow any other languages , special characters, spaces, otherwise it will fail to be imported !


III. Operation Guide

10.3D-LUT Output Method

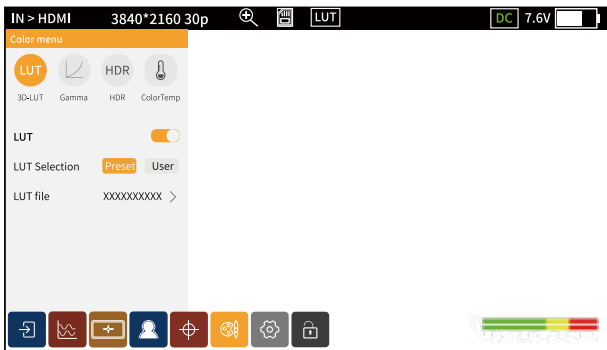

- 1 Click the color management-3D-LUT icon, open X  select the corresponding LUT file, and the preset LUT color adjustment effect can be recorded into the file synchronously during recording.
- 2 The LUT for HDMI/SDI output is the same as the LUT that is turned on.

11.DCI-P3

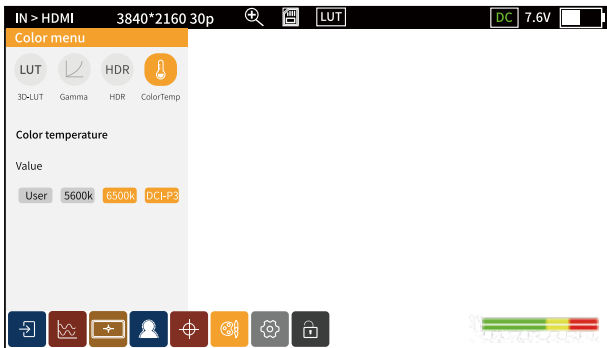

IV. Notes

1. Exceptions in Connection

- a. Zoom, Anamorphic, Waveform, these three functions can only be opened one at a time. Such as when the Anamorphic function is open, has opened the Zoom or Waveform will be forced to close.
- b. When HDMI IN, there is no SDI output. When SDI IN, both HDMI and SDI can be output.

2. SD Card Description :

SD Card Identification and Use Problems

- a. The SD card of this product does not support hot-swapping, if the SD card is inserted and removed during use, causing abnormalities such as the card cannot be recognized and the screen interface cannot be operated, please restart the device.
- b. The newly purchased SD card has to formatting by monitor's "SD Card Format" function before normal use.
- c. The recommended capacity of SD card is 32G-128G

V. Technical Parameters

Model No.	M7
Screen Size	7"TP
Screen Resolution	1920*1080
Aspect Ratio	16:9
Brightness	2000nits
Color Gamut	DCI-P3
Contrast Ratio	1800: 1
Viewing Angle	170° (H/V)
Output Interface	HDMI output, SDI output, 3.5mm Headphone output
Input Interface	HDMI input, SDI input, SD Card Slot, DC In
LUT Format	cube file (17*17*17 and 33*33*33) ^①
Audio Frequency	48kHz
Power Supply Method	NP-F / DC IN
Input Voltage	DC7-16V
Power Consumption	< 10W
Firmware Updates	SD card updates
HDMI&SDI-Lut Output	support
Material	CNC aluminum alloy shell
Product Color	blue grey


V. Technical Parameters

HDMI Input Signal Formats	4096*2160P25/24/23.98
	3840*2160P30/23.98/25/24/23.98
	1920*1080p60/59.94/50/30/29.97/25/24/23.98
	1920*1080i60/59.94/50
	1280*720p60/59.94/50
SDI Input Signal Formats	1920*1080p60/59.94/50/30/29.97/25/24/23.98
	1920*1080PSF30/29.97/25/24/23.98
	1920*1080i60/59.94/50
	1280*720p60/59.94/50
HDMI Output Signal Formats	1920*1080p60/50/30/25/24
	1920*1080i60/50
	1920*p60/50
SDI Output Signal Formats	1080p60/50/30/25/24/
	1080i60/50 720p60/50
	support SDI-LOOP OUT mode
Weight	455g
Unit Size	178.8*110.8*20.3/28.3mm

Please-note:

- ① The LUT file to be imported, It is under "Lut" folder of root directory in SD card, and the LUT files should not exceed 50.

SHIMBOL

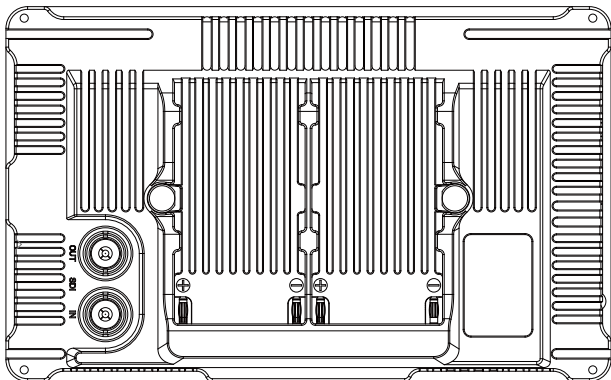

Tel+86 0755-21004986

URL:www.zeroone-video.com

Address: 2C, 2nd Floor, Building 6, Longbi Industrial Park
No.27 Dafa Road, Bantian Street, Longgang District, Shenzhen
Shenzhen ZO Video Technology Co., Ltd.